

*Need to be
11,20mm*





***Need to be
13,70mm***



***Need to be
31,75mm***

*Need to be
16,30mm*






***Need to be
16,30mm***

***Need to be
2,40mm***




**2,40mm =>
dimension OK**

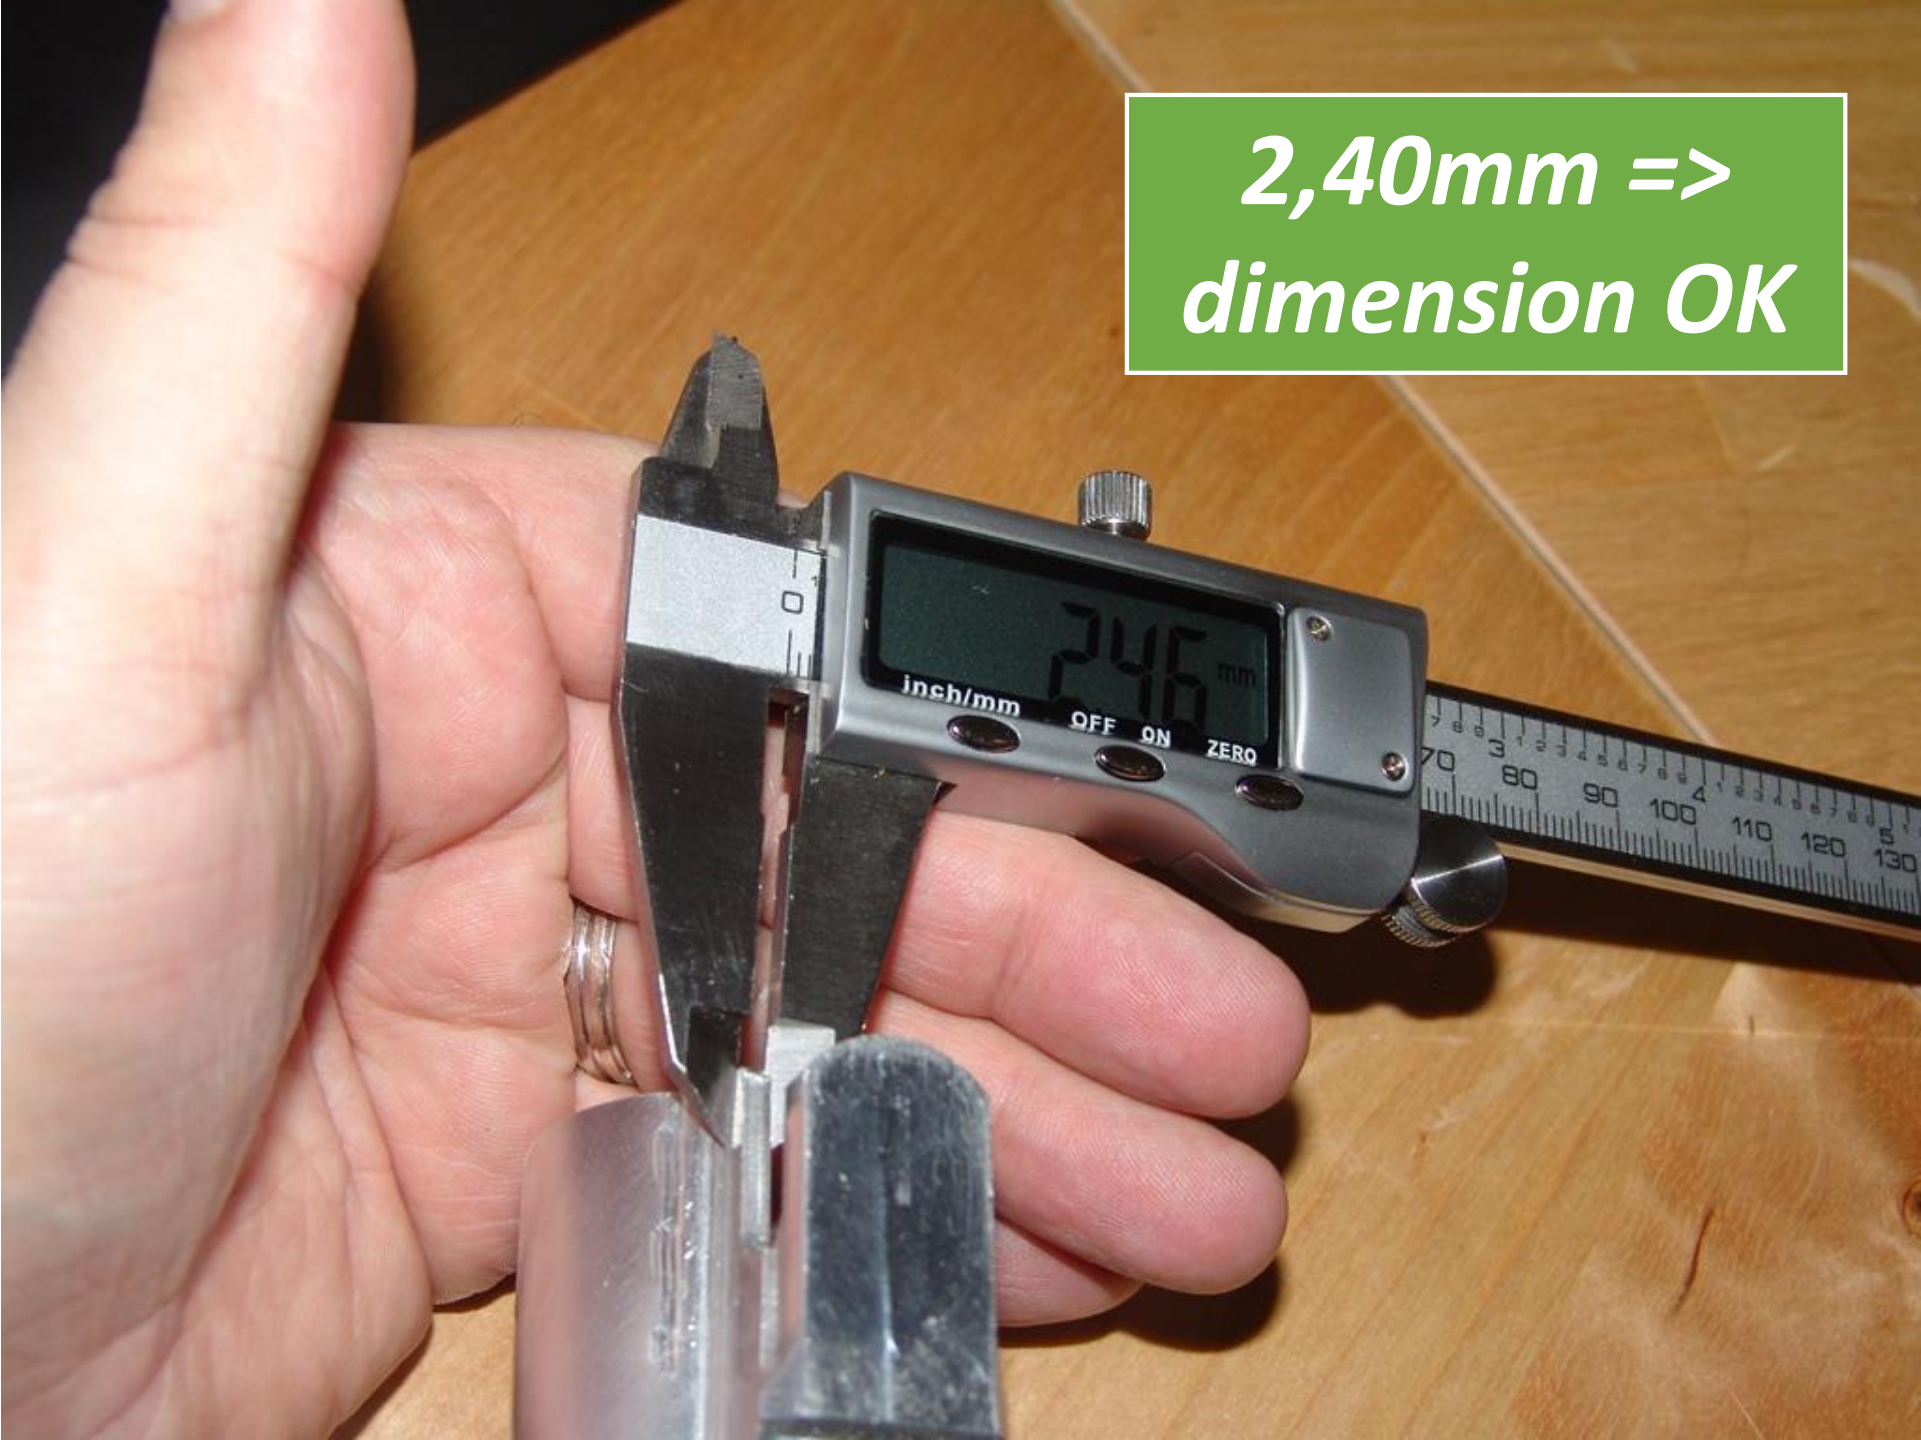




***Need to be
21,00mm***

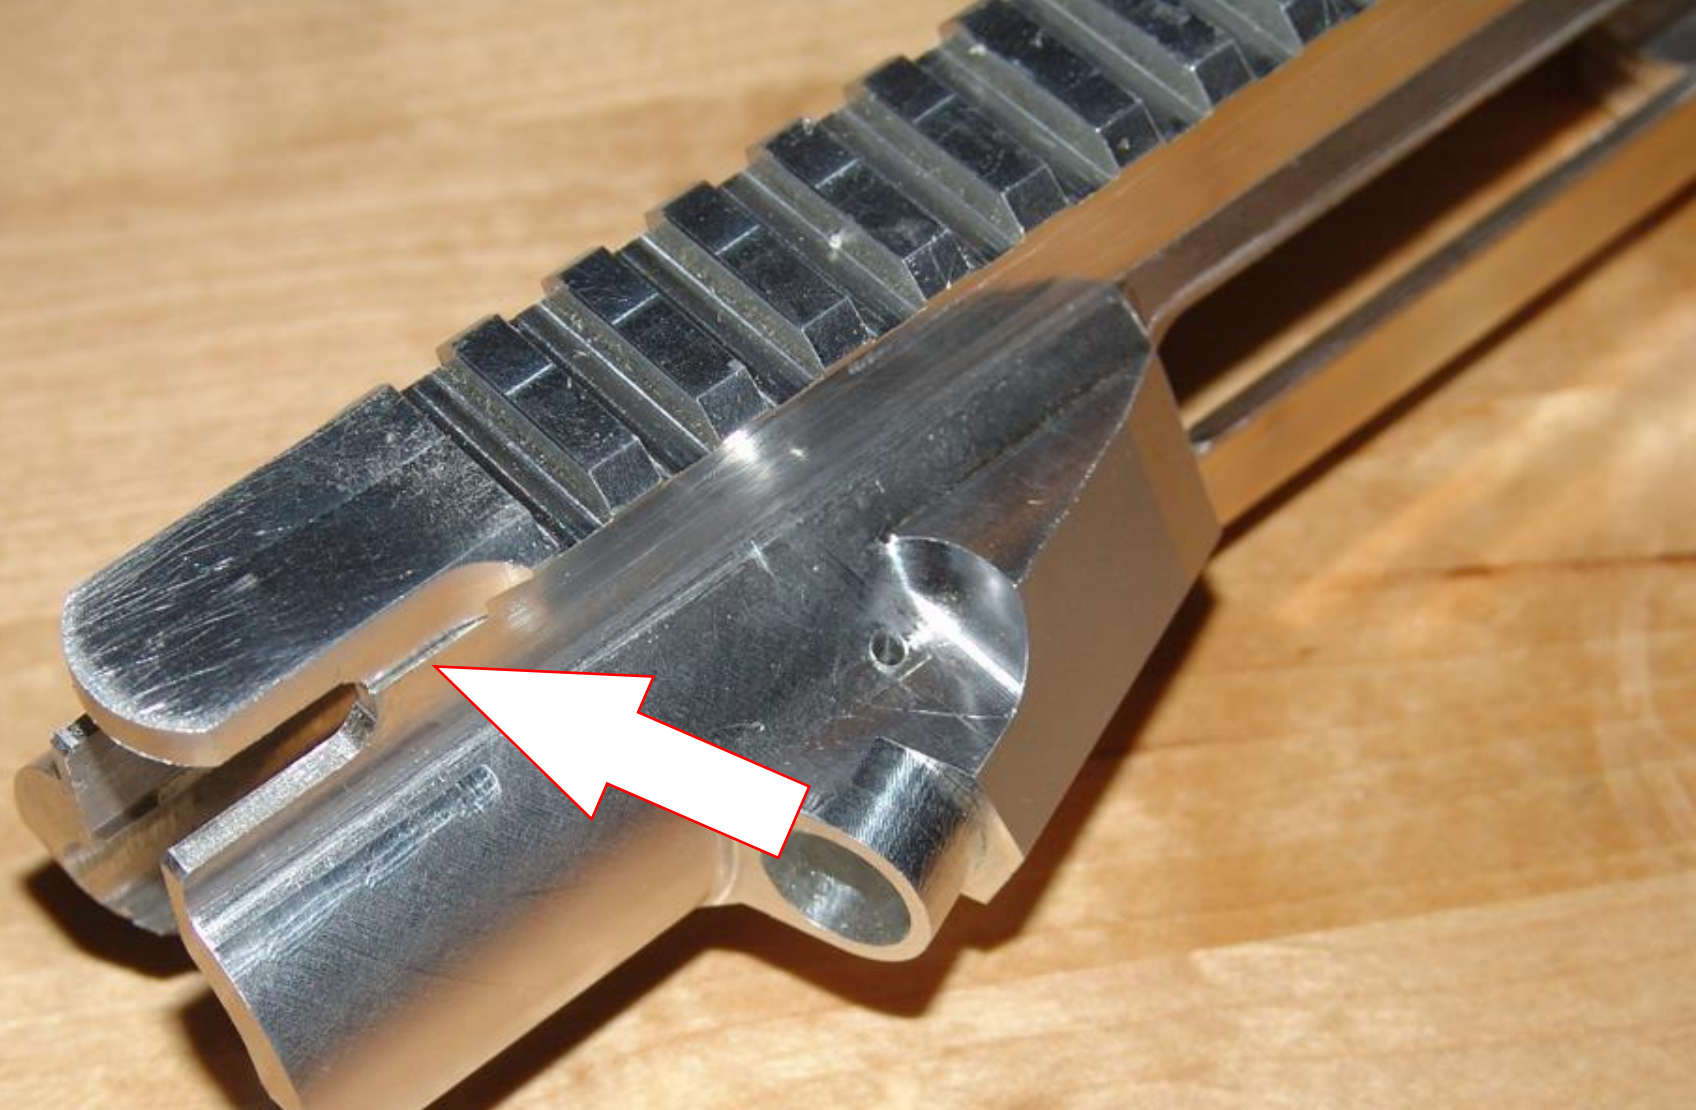

***Gap between 2 faces
See next slide for explanations***

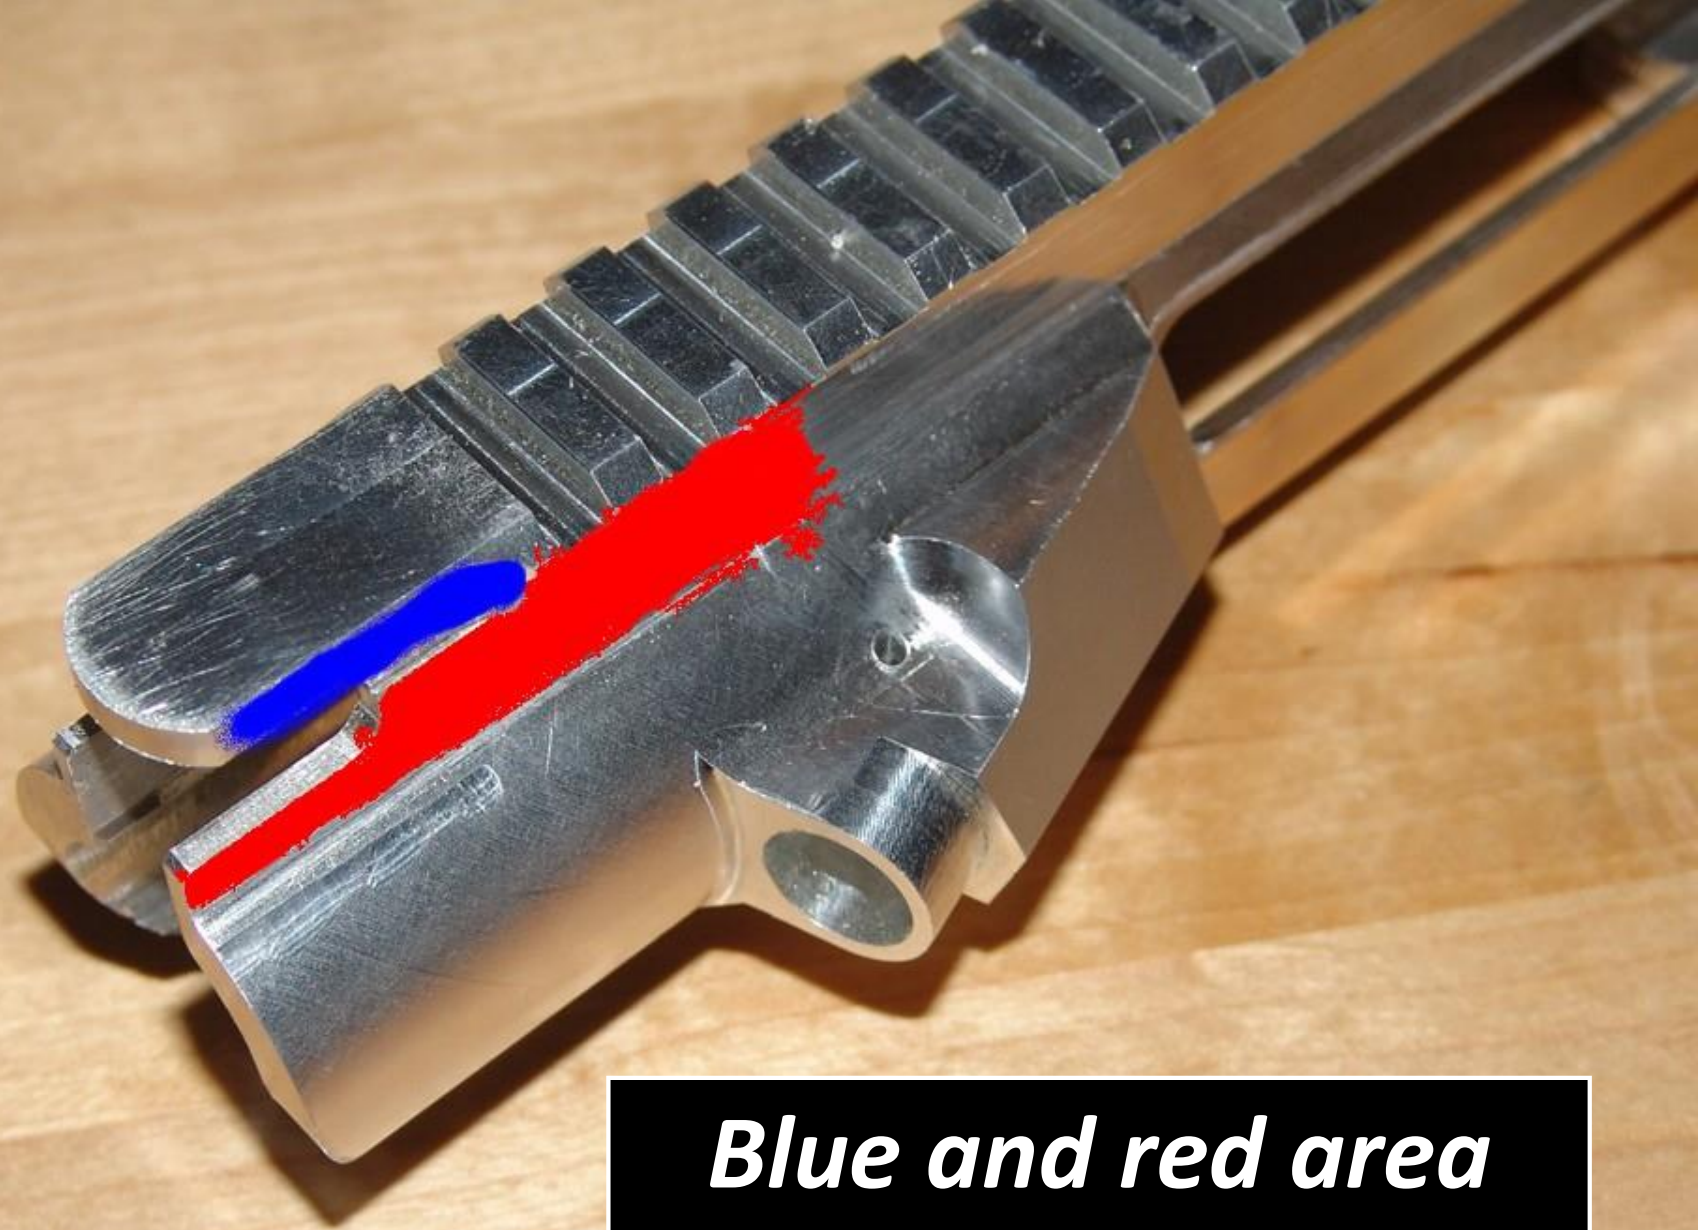

*Blue and red area
need to be the same*



***Gap between 2 faces
See next slide for explanations***



*Blue and red area
need to be the same*




***Ø3,20mm drill
is missing***

*Form and
dimension NOK*


*Form and
dimension OK*



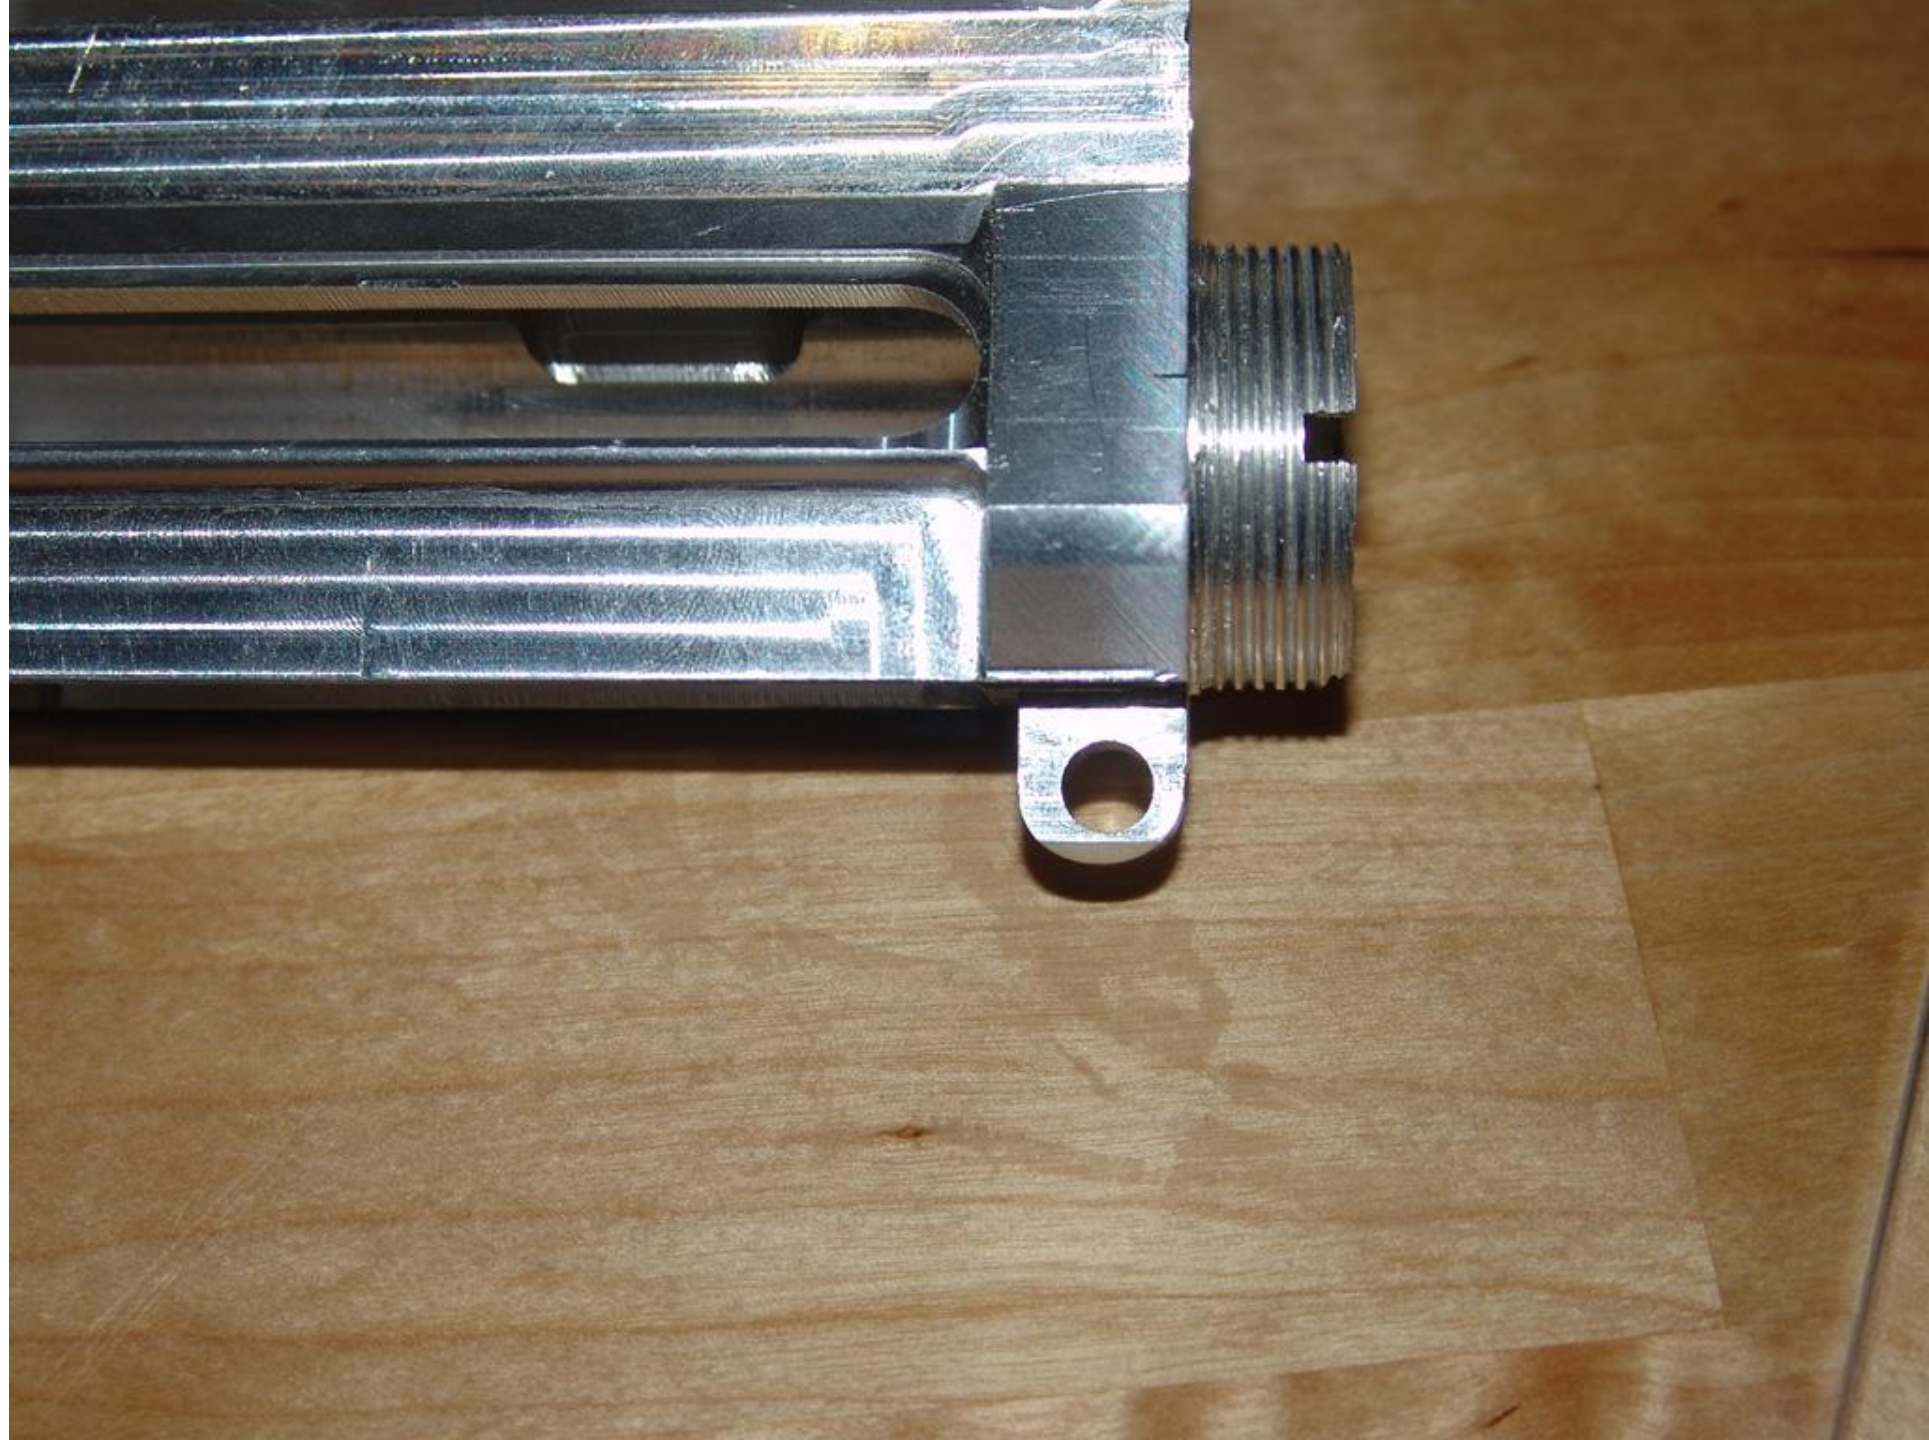



*Hole need to be
moved : 0,5mm*

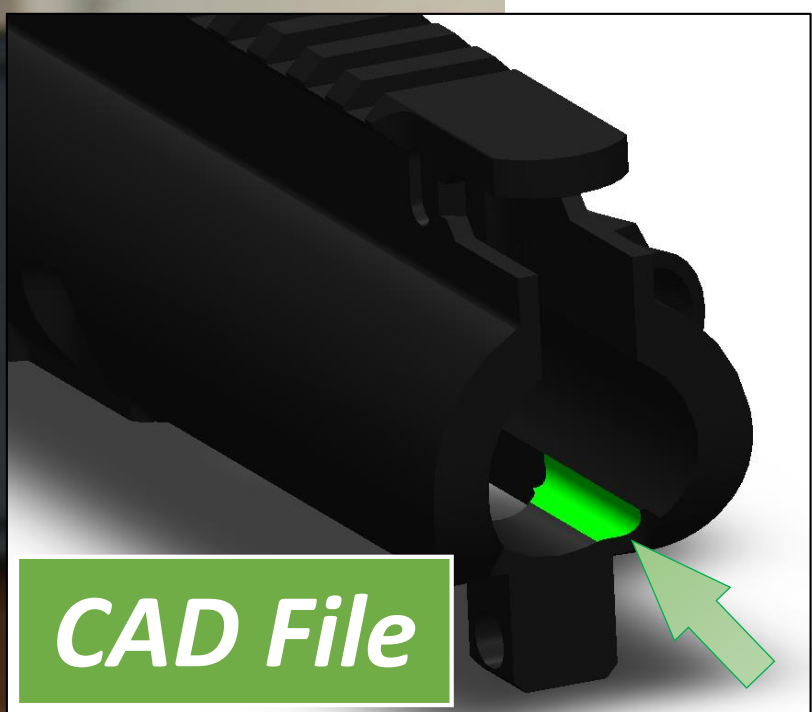

***Machining area
is missing***

CAD File